


20 404 000 **COSTA PILLAR TAP**




PRODUCT DESCRIPTION

- Colour: chrome
- Trecorn handle
- chrome plated plastic
- heat-insulated, screwed union
- marking: blue
- cast spout with economy mousseur
- union nut with 10.5 mm drilling
- GROHE Long-Life finish

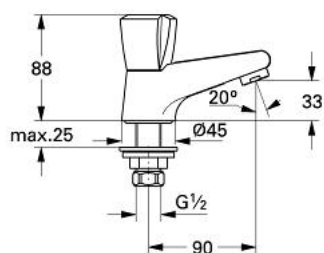

20 404 000 COSTA PILLAR TAP

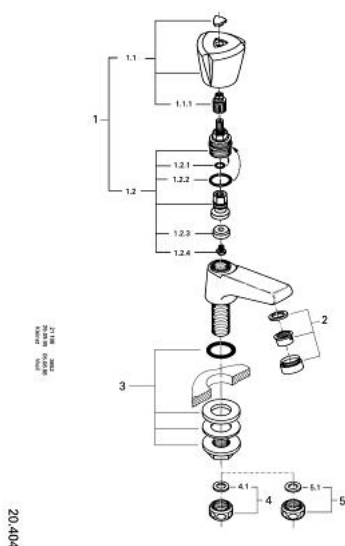

SPARE PARTS, January 1994 – now

- 1: Headpart 1/2" (Spare part-nr. 45534000)
- 1.1: Costa handle, blue/red (Spare part-nr. 45970000)
- 1.1.1: Repl. kit f.handle fastening (Spare part-nr. 0538600M)
- 1.2: Headpart 1/2" (Spare part-nr. 07146000)
- 1.2.1: O-ring $\varnothing 6 \times \varnothing 2$ (Spare part-nr. 0128300M)
- 1.2.2: O-ring $\varnothing 18.2 \times \varnothing 1.7$ (Spare part-nr. 0392400M)
- 1.2.3: Ball seal dia. 9×6.8 mm (Spare part-nr. 0529100M)
- 1.2.4: Ball seal dia. 9×6.8 mm (Spare part-nr. 0529100M)
- 2: Economy Mousseur (Spare part-nr. 13951000)
- 3: Shank fastening assembly (Spare part-nr. 45000000)
- 4: Coupling nut 1/2" x 14.5 mm (Spare part-nr. 1290200M)
- 4.1: Fibre seal dia. 12×2 mm (Spare part-nr. 0138900M)
- 5: Coupling nut 1/2" x 10.5 mm (Spare part-nr. 1290100M)
- 5.1: Fibre seal dia. 12×2 mm (Spare part-nr. 0138900M)